

Date: Thursday, 26/02/2009 11:41:48 AM
 User: Julie Dawson

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 212/205 HIGH FED X-TUBE ASSEMBLY
Job Number : 46095	
Estimate Number : 10254	
P.O. Number :	Part Number : D212664101
This Issue : 26/02/2009 S.O. No. :	Drawing Number : D212-664-141 REV C
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : CROSSTUBES	Drawing Revision : C
Previous Run : 46094	Material :
Written By :	Due Date : 18/03/2009 Qty: 1 Um: Each
Checked & Approved By : <u>JLD 09-02-26</u>	
Comment : Est Rev:E 04.02.16 Reformat KJ/DS Est Rev:F 06-03-29 Remove Coments on Pick List JLM Est Rev:G 07-04-30 As per Rev C JLM	

Additional Product

Job Number:



SCRAP

Seq. #: Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL

**Comment:** DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D212-664-101 CHG003

2.0

PACKAGING 1

PACKAGING RESOURCE #1

**Comment:** PACKAGING RESOURCE #1

3.0

D212664101TRN

Crosstube Turning Detail

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

CROSSTUBE TURNING DETAIL

batch B-45003MB 09-03-05 ①

4.0

BENDING

BENDING MACHINE - SKIDTUBES

**Comment:** BENDING MACHINE

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio FT015

MB 09-03-05 ① *(PTC)*

5.0

QC15

DIMENSIONAL CHECK OF X-TUBES

**Comment:** DIMENSIONAL CHECK OF X-TUBES

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D812-664-101 PAR #: N/A Fault Category: Red/x-tube NCR: Yes No DQA: D Date: 09/03/13
 Resolution: SCRAP Disposition: Scrap QA: N/C Closed: D Date: 09/03/107

NCR: <u>46095</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
09.03.09	4	Tube bent high. Narrow on one side. Rci process	<u>AS</u> <u>PST 42</u> <u>09/03/10</u>	<u>KS Total width < 107".</u> <u>Too high on one side</u> <u>(+0.625 from nominal)</u> <u>SCRAP TUBE</u> <u>Donate to eng lab.</u>	<u>SK</u> <u>09-03-12</u>	<u>09.03.11</u>	<u>AS</u> <u>PST 42</u> <u>09/03/10</u>	<u>09.03.11</u>

NOTE: Date & initial all entries

Date: Thursday, 26/02/2009 11:41:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 46095

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141

4-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1 within 24 hours of bending and drilling

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

9.0

OUTSIDE SERV.11

OUTSIDE SERVICE -CROSSTUBES



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038

Issue P/O: _____

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

10.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect for damage & ensure results are as per Dwg D212-664-141

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 26/02/2009 11:41:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 46095

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PRIME:

Start Time: _____

Finish Time: _____

PAINT:

Start Time: _____

Finish Time: _____

13.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

14.0

D28931

2.75 Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2893-1 Support _____

15.0

D3595063450

RUBBER CUSHION



Comment: Qty.: 4.2000 Each(s)/Unit Total : 4.2000 Each(s)

Rubber Cushion (per sq ft)

.630" X 4.5" 4PCS

Batch: _____

16.0

MS2192025

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-25 Clamp _____

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 26/02/2009 11:41:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 46095

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2-Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs

A/R 6398 Magnobond Batch: _____

Expiry Date: _____

3-Install clamps as per Dwg D212-664-141. Torque clamps to 80-100 in lb.

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

19.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

20.0

D34281

Placard



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

PLACARD

Batch: _____

21.0

AN635A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: _____

22.0

AN636A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: _____

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 26/02/2009 11:41:48 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 46095

Part Number: D212664101

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

AN960JD616

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Washer

Batch: _____

24.0

MS21042L6

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Nut

Batch: _____

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Identify and pack for shipping as per PPP D212-664-101

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



mf
09-0313

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: H6095	
Description: Crosstube High Fwd (205/212/412)	Part Number: D212-664-101	
Inspection Dwg: D212-664-141	Rev: C	Page 1 of 1

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

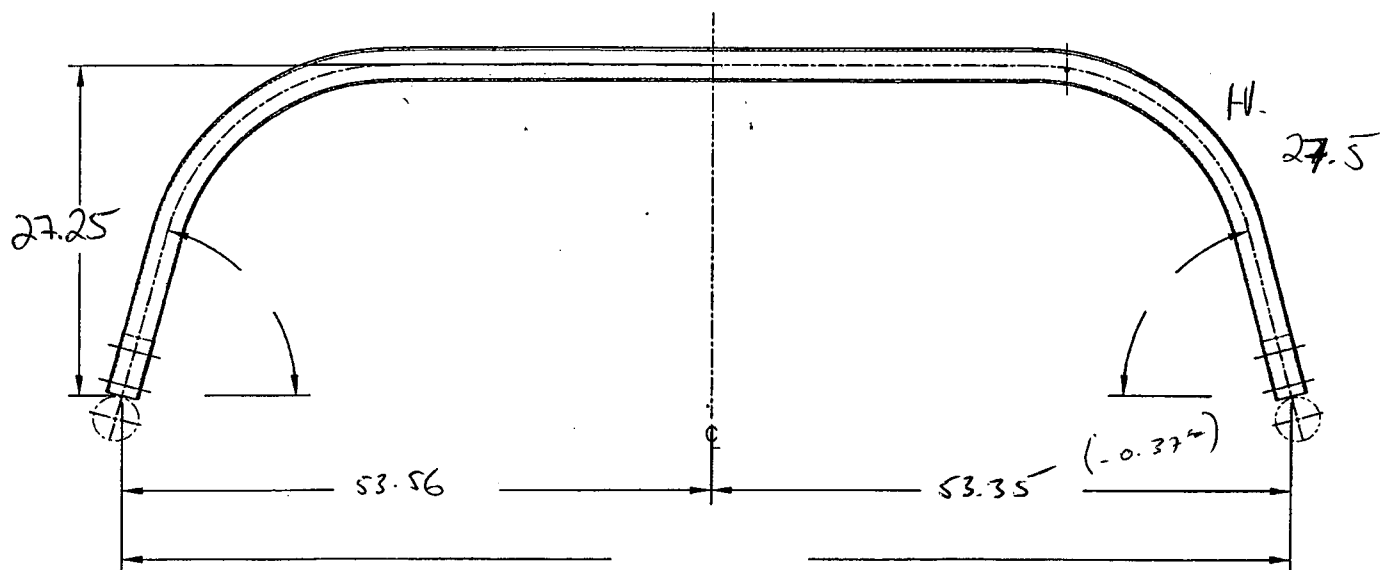

Comments
Scrap tube. Too high. Too narrow (2167")

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	



DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED GP	APPROVED [Signature]	DRAWING NO. D212-664-141	REV. C SHEET 1 OF 3
DATE 07.03.08		TITLE XTUBE ASS'Y (205/212/412 HI FWD) NTS	
A	00.12.12	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
C	07.03.08	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	

RELEASED

07.04.24 **[Signature]**

Qty	Part Number	Description
X	D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
1	D6005-128	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
4	MS21920-25	CLAMP (OR MS21920-26)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)






GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.51±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 10) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **41095**

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

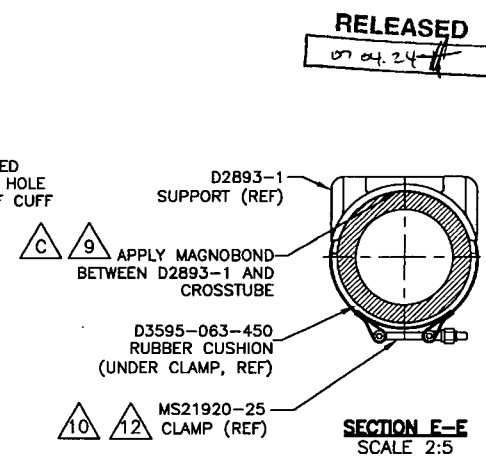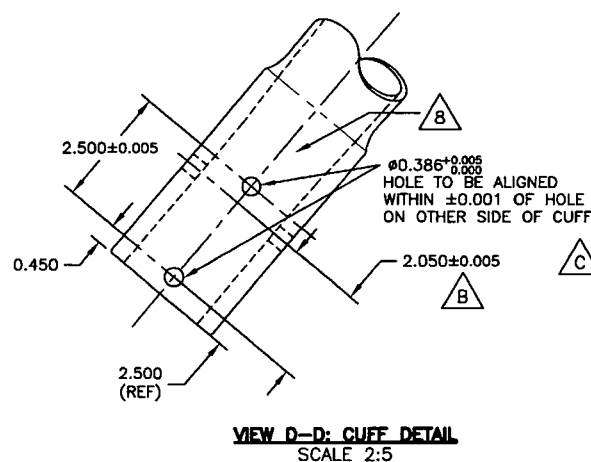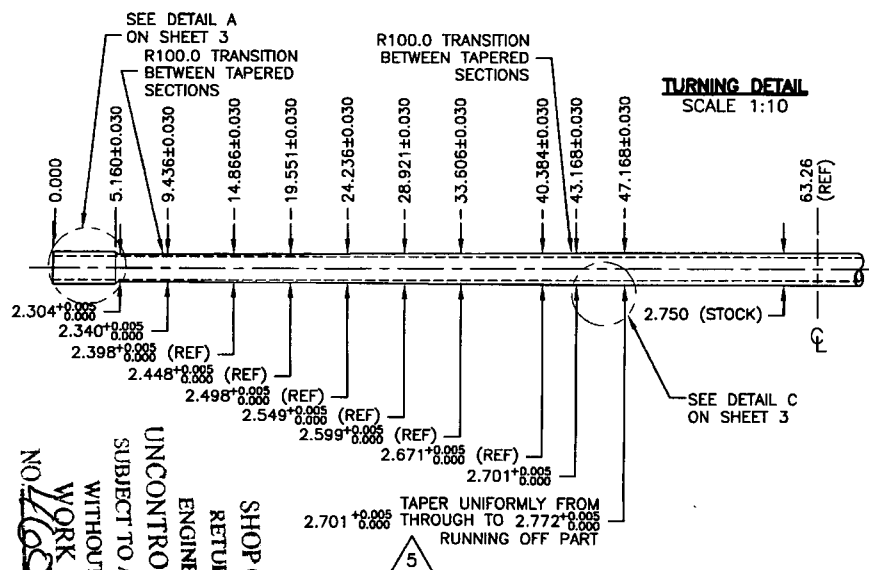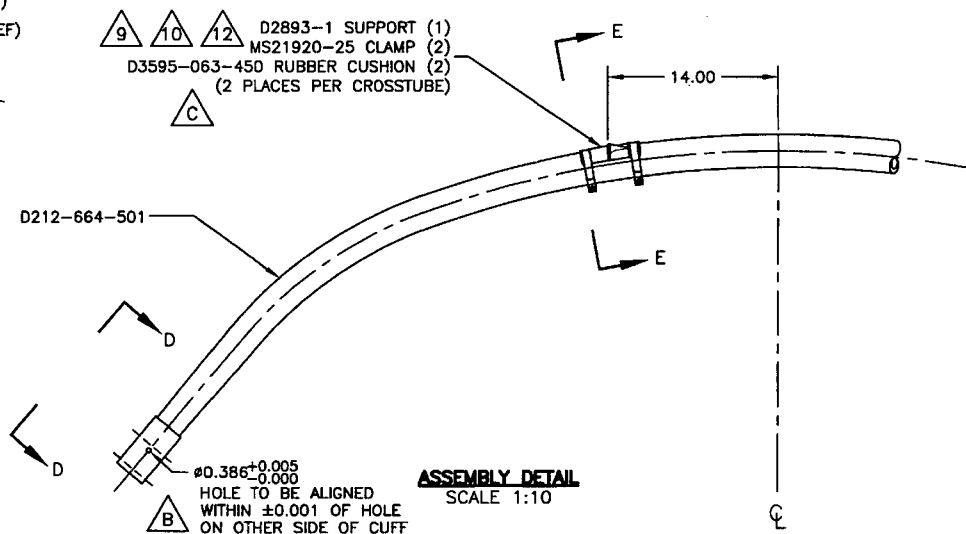
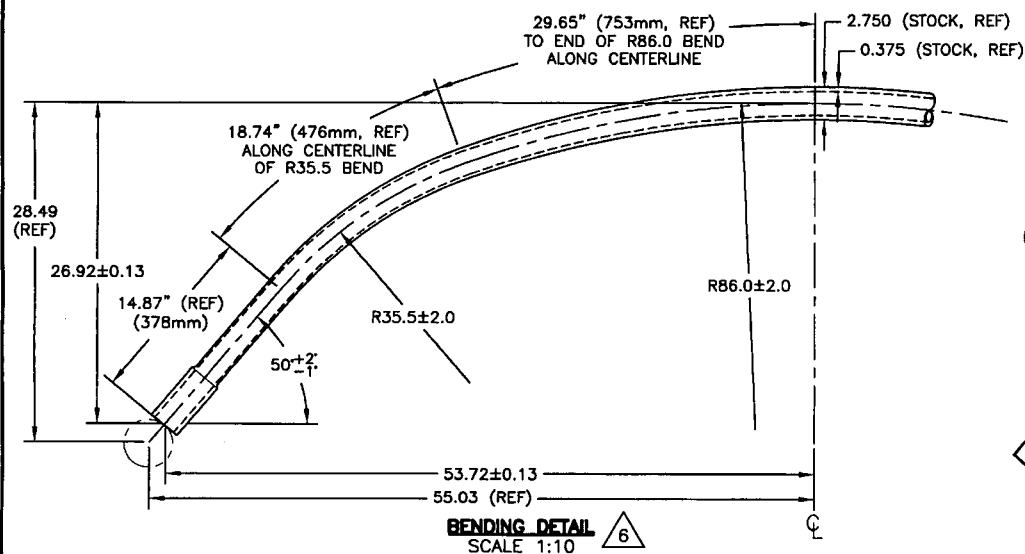


RELEASED
04.24

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 220075


COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. HARNESSBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	92	APPROVED	4	DRAWING NO.	REV. C
		DATE	07.03.08			D212-664-141	SHEET 2 OF 3
						XTUBE ASS'Y (205/212/412 HI FWD)	SCALE 1:10

RELEASED
 87.04.24 P
 PER E.N. 983

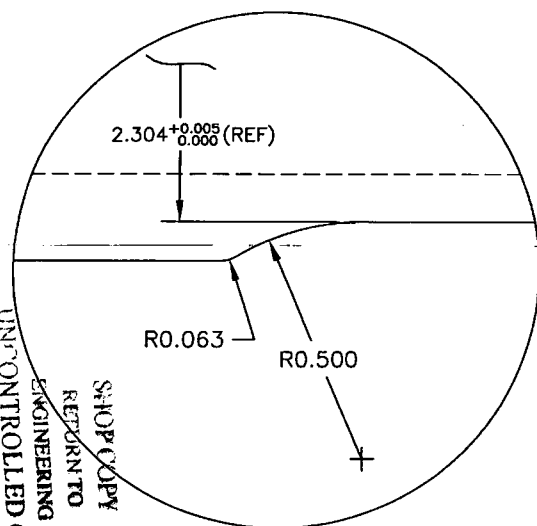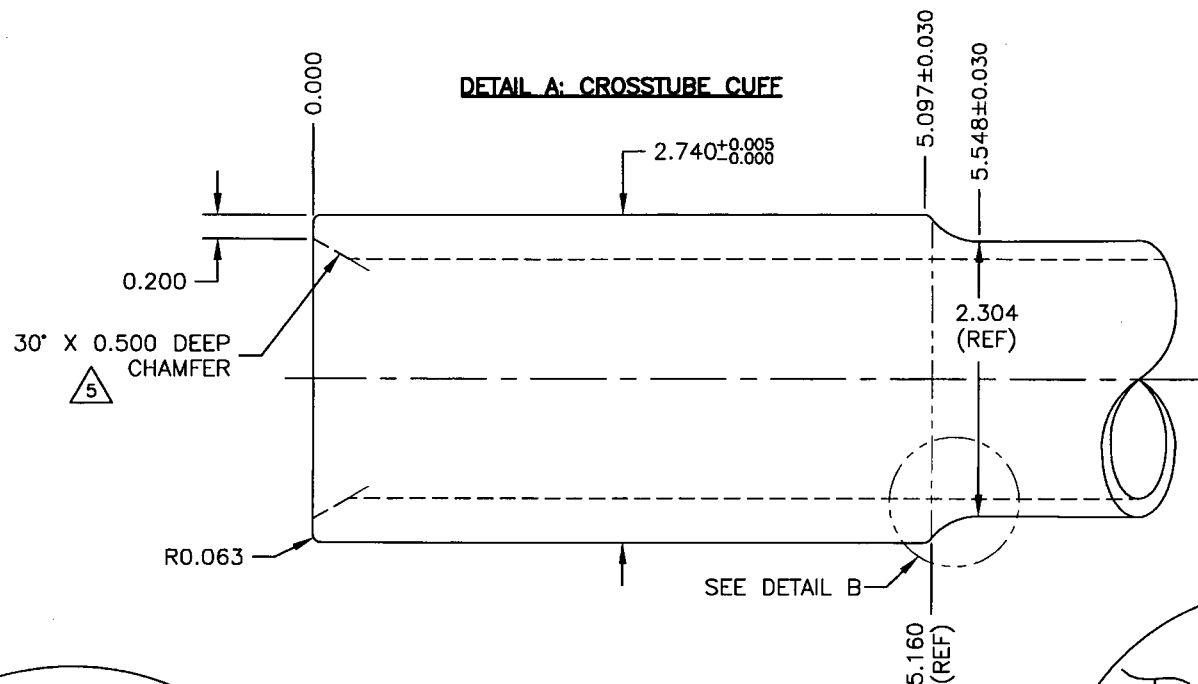

**DETAIL B: CUFF
 TRANSITION**
 SCALE 4:1

**DETAIL C:
 TAPER RUN-OFF**
 NOT TO SCALE

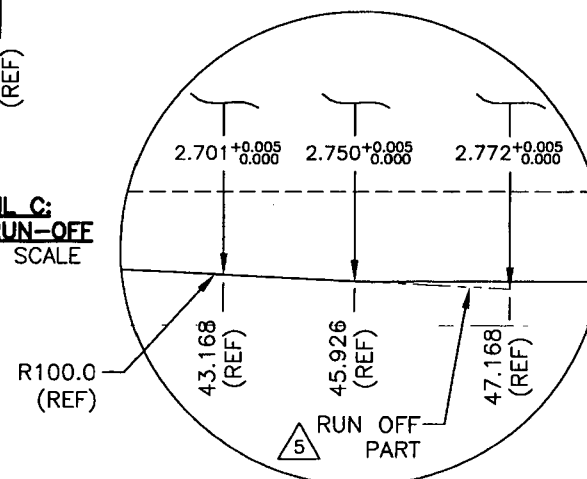

NO. 1001
 WORK ORDER
 WITHOUT NOTICE
 SUBJECT TO AMENDMENT
 UNCONTROLLED COPY
 ENGINEERING
 RETURN TO
 SHOP COPY
 1001

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	PH	APPROVED	PH	DRAWING NO. D212-664-141	REV. C SHEET 3 OF 3
DATE 07.03.08		TITLE XTUBE ASS'Y (205/212/412 HI FWD)		SCALE 1:1			